

Rough Engine Idle Or Misfire On 1999-2000 GM 2.4L VIN T Engines

The AERA Technical Committee offers the following information regarding a rough engine idle or misfire on 1999-2000 GM 2.4L VIN T engines. Some customers may comment on this condition and the CHECK ENGINE light may become illuminated.

Causing this type of condition is a possible spark plug boot spring missing as shown in Figure 1. Check for the presence of the spark plug boot spring by removing each boot and checking for the spring presence at the boot to coil tower connection. If the spring is missing, replace the spark plug boot assembly under Part #12132224.

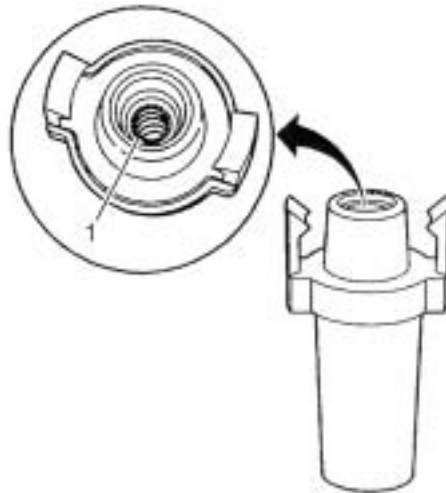


Figure 1 - Sparkplug Boot Spring

Portions of materials contained herein have been reprinted with permission from General Motors Corporation, Service Operations

Information is from best available sources and is accurate at the time of publication. However, Jasper Engines & Transmissions ASSUMES NO RESPONSIBILITY and cannot be held liable for any results or consequences regarding the use of this information.